



Clamp 02 : 'V' groove gasket

COMPONENTS

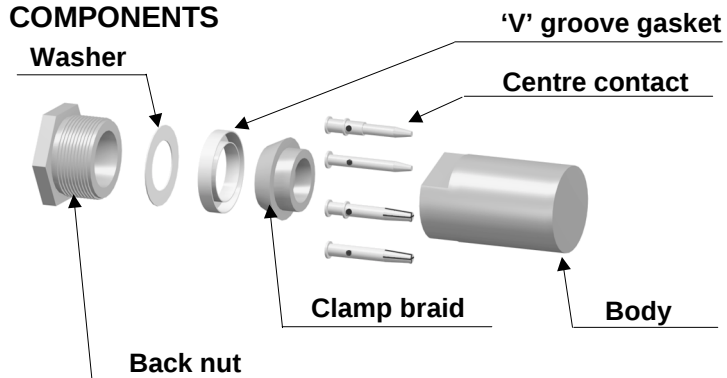


STRIPPING DIMENSIONS

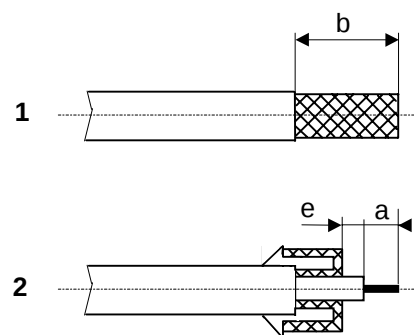


1

Strip the cable as shown in sketch 1.

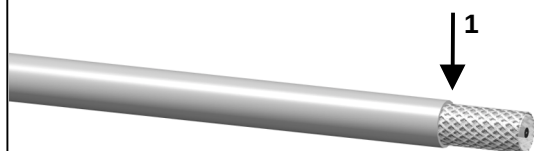


4

Slide the back nut over the cable assembly.
Slide the centre contact onto the inner conductor.

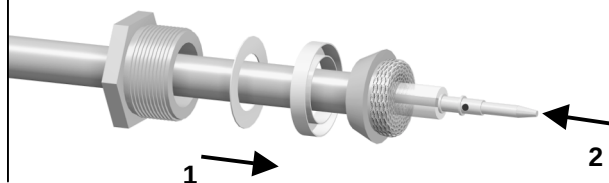


2

Slide the back nut, the washer and the 'V' groove gasket
onto the cable.
Slide the clamp braid sleeve over the braid.

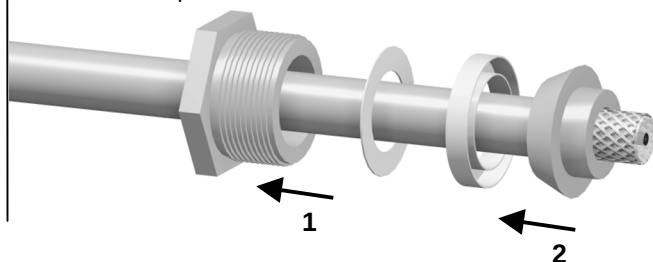


5

Solder the centre contact onto the inner conductor.

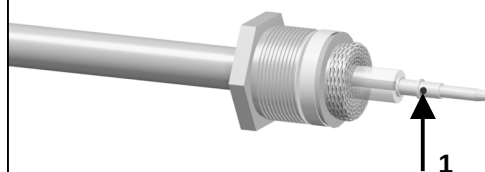

3

Fold the braid back and trim off the extra braid.
Trim dielectric back as shown in sketch 2.

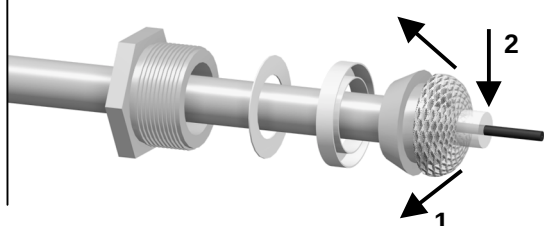

6

Screw sub-assembly into the connector body with the adapted
wrench.
Recommended coupling torque (see connector TDS).

