

VERTEX™ 8105

2M SHOCK ABSORBING WEBBING LANYARD COMPLETE WITH SCAFFOLD HOOK & SC KARABINER

**TECHNICAL
SPECIFICATION**

WORKING AT HEIGHT

BEFORE USE

The lanyard must be inspected to ensure the condition of the webbing and stitch patterns

If there is evidence of abrasion, cuts or burns on the webbing the lanyard should be replaced

If there is corrosion, cracks, distortion or burs on the metal fittings the lanyard should be replaced

If there are any broken, worn or pulled stitches that appear unravelled the lanyard should be replaced

DURING USE WITH A HARNESS

Ensure a snug fit is achieved when fitting. An over-tight or loose harness will not provide the appropriate level of protection

Ensure the harness straps are not twisted when fitting

The anchor point must be situated above the user's head with slack kept minimum

Fall Protection devices should be attached to either the front or rear 'D' ring using a suitable connector/karabiner

Work Positioning Devices must only be attached by side 'D' rings

Never use side 'D' rings for Fall Arrest

Clearance below the user should be minimum of 5M for a 2M Absorbing Lanyard - This is the potential extension of the Lanyard plus the user body length

The harness must not be used for falling heights of less than 2M

Protect all equipment from sharp objects. Work positioning Lanyards must be passed anchorages that have sharp edges

Do not use in locations that have extremes in temperature or will give exposure to chemical contamination

INSTRUCTIONS FOR USE

Fit the lanyard as per instructions supplied with the product

The lanyard should be issued on a personal basis with all the relevant information kept on the record card



ANCHORAGE POINTS & CONNECTORS

Always check the suitability of any anchor point - if in doubt, do not use

Ensure a connector of a suitable size and design is used

Anchor points, which are too large for karabiners or connectors, must be secured with a sling

Wherever possible, attachments specified for the job should be used

Never loop safety lines over attachment points or beams

Any connector that is misused may be severely reduced in strength

A Safety Line must never be tied around attachment points or beams

The anchor point must be able to withstand 10kN

Anchor points must be checked after any fall for signs of deterioration

Never apply multiple loads to any connector

Moving parts on connectors should be cleaned regularly with water that does not exceed 40°C. Allow to dry naturally and lubricate with a silicone-based product

CONFORMITY

The components meet the requirements of the following:

Energy Absorber - EN 355:1992

Lanyard - EN 354:1993

Pipe Hook - EN362:1992

Karabiner - EN362:1992

EC Certificate Number 00060042, 00060056 and 01060103, issued by Berufsgenossenschaftliches Institut für Arbeitssicherheit (0121)

EC Certificate Number 1503 issued by Satra Quality Assurance (0321)

TECHNICAL SPECIFICATION

2M SHOCK ABSORBING WEBBING LANYARD COMPLETE WITH SCAFFOLD HOOK & SC KARABINER

WORKING AT HEIGHT

DIMENSIONS OF OUTER PACKAGING


Quantity: 20

Weight: 26Kg

DIMENSIONS OF LANYARD

Length: 2M

Weight: 945g (Approx)

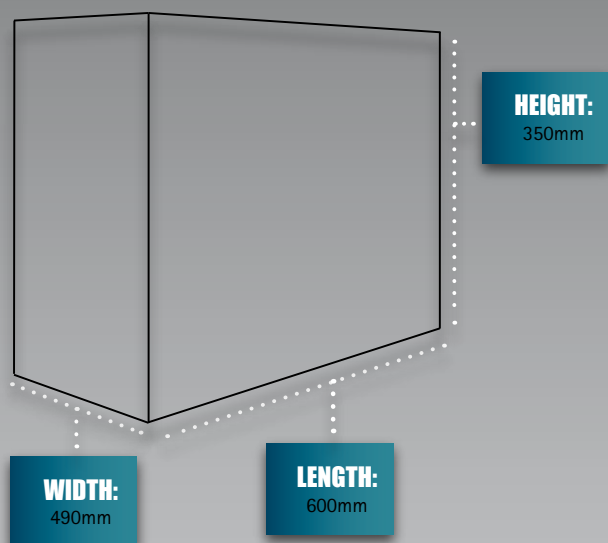

MATERIALS

Polyamide Straps

Steel Fittings



LIMITATIONS OF USE

Protection will only be offered if the lanyard is fitted correctly to the user wearing an appropriate harness and a suitable anchor point

The lanyard, when in contact with the skin may cause allergic reactions to susceptible individuals

If this occurs leave the hazard area, remove the harness and seek medical advice

The attention of users is also drawn to the dangers of modifying or removing any of the original component parts, other than as recommended by the manufacturer

Any harness and arrest system subjected to a fall should be replaced immediately

All Fall Arrest equipment supplied by JSP Ltd is suitable for only that intended use. In no way must any of the component parts be used for Rock Climbing, Mountaineering or any other such activity

Do not apply paint, solvents, adhesives or self-adhesive labels, except in accordance with instructions from the manufacturer

CLEANING & MAINTENANCE

For minor soiling, the lanyard may be cleaned with a cotton cloth or soft brush.

For intensive cleaning, wash at a temperature of 30°C using a neutral detergent

When not in use, keep the lanyard clear of any sharp objects, store in a well ventilated area away from extremes of temperature and bright sunlight

Do not place heavy items onto the harness. If wet, allow the lanyard to completely dry before storing