

Weller®

# Desoldering & Rework Stations



**COOPER** Hand Tools



# Content

| Weller Desoldering & Rework stations                                                                                                                      |       | Soldering Tips                                                               |    |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------|-------|------------------------------------------------------------------------------|----|
| Weller Multi-Digital Rework Station WMD 3<br>(With In-Built Pump)                                                                                         | 4     | Soldering Tips<br>for soldering iron LR 82                                   | 16 |
| Weller Multi-Digital Hot Air Station<br>WMD 1A (With In-Built Pump)                                                                                       | 5     | Soldering Tips<br>for soldering pencil LR 21                                 | 17 |
| Weller Multi-Digital Desoldering Station<br>WMD 1D (With In-Built Pump)                                                                                   | 6     | Soldering Tips<br>for soldering pencil MLR 21                                | 18 |
| Weller Multi-Functional,<br>Digital Desoldering Station WDD 161V                                                                                          | 7     | Soldering Tips<br>for micro soldering pencil WMP                             | 19 |
| Weller Multi-Functional,<br>Digital Desoldering Station WDD 81V                                                                                           | 8     | Soldering Tips<br>for WSP 80, WSP 80IG, WSP 80FE and MPR 80                  | 20 |
| Weller Multi-Functional, Digital<br>Hot Air Station WAD 101                                                                                               | 9     | Soldering Tips<br>for WSP 80, WSP 80IG, WSP 80FE and MPR 80                  | 21 |
|                                                                                                                                                           |       | Soldering Tips<br>for soldering iron WSP 150<br>for WT 50 and WTA 50 tweezer | 22 |
| Weller Flexibility.                                                                                                                                       |       | Additional Safety Rests                                                      |    |
| Refer to the matrix to make your choice of<br>connecting tools for the WMD 3, WMD 1A + D,<br>WDD 161V, WDD 81V + VIL and WAD 101                          | 10-11 | Safety rests with Stop+Go Function<br>Standard Safety rests                  | 23 |
| Accessories                                                                                                                                               |       |                                                                              |    |
| CSF Accessories<br>for DS 80 (DS 80UNC), DSX 80, DSV 80<br>(DSV 80UNC), DSXV 80, DXV 80 and DSVT 80<br>for SMD's chip desoldering tiptlets for flat packs | 12    |                                                                              |    |
| Accessories<br>For easier rework and repair, Weller has a<br>large range of desoldering nozzles and<br>soldering nozzles.                                 | 13    |                                                                              |    |
| Hot Air Nozzle                                                                                                                                            |       |                                                                              |    |
| Hot Air Nozzle<br>for hot air pencil HAP 1                                                                                                                | 14    |                                                                              |    |
| Hot Air Nozzles<br>for hot air pencil HAP 1                                                                                                               | 15    |                                                                              |    |

# Matrix

Weller®

Weller brings to the market an extended generation of versatile soldering/desoldering, SMD rework stations and tools. Performance has been increased with soldering irons and desoldering irons up to 150 W.

Choose between Weller stations with powerful in-built pumps, or smaller units without pumps that allow you to connect to your own factory line.

All Weller stations easily connect to a variety of new and existing Weller tools and accessories to provide even greater flexibility. The matrix below makes selection easy, and puts you firmly in control of all your workbench needs.



|                                                                                                                                                                   | WMD 3 | WMD 1 | WAD 101 | WDD 81V | WDD 161V |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------|-------|---------|---------|----------|
|  HAP 1 Hot Air Pencil<br>(KH 20 Support for HAP 1)                               | ■     | ■     | ■       |         |          |
|  DSX 80 Desoldering Iron 80 W<br>(AK 20 Support for DSX 80)                      | ■     | ■     |         | ■       | ■        |
|  DXV 80 Desoldering Iron 80 W<br>(AK V Support for DXV 80)                       | ■     | ■     |         | ■       | ■        |
|  LR 21 Soldering Pencil 50 W<br>(KH 20 Support for LR 21)                       | ■     | ■     | ■       | ■       | ■        |
|  LR 82 Soldering Iron<br>(KH 27 Support for LR 82)                             | ■     | ■     | ■       | ■       | ■        |
|  WSP 80 Micro Soldering Pencil<br>(WPH 80 Support for WSP 80)                  | ■     | ■     | ■       | ■       | ■        |
|  WSP 80 IG Inert Gas Micro Soldering Pencil<br>(WPH 81T Support for WSP 80 IG) |       |       | ■       |         |          |
|  WSP 150 Soldering Iron 150 W<br>(KH 27 Support for WSP 150)                   | ■     | ■     |         |         | ■        |
|  MPR 80 Antistatic Peritronic 80 W<br>(KH 25P Support for MPR 80)              | ■     | ■     | ■       | ■       | ■        |
|  WMP Micro Soldering Pencil 65 W<br>(WPHM Support for WMP)                     | ■     | ■     | ■       | ■       | ■        |
|  WST 20 Thermal Wire Stripper 50 W<br>(support included)                       | ■     | ■     | ■       | ■       | ■        |
|  WST 82 Thermal Wire Stripper 80 W<br>(support included)                       | ■     | ■     | ■       | ■       | ■        |
|  WHP 80 Preheating Plate                                                       | ■     | ■     | ■       | ■       | ■        |
|  WTA 50 Tweezer<br>(AK 51 Support for WTA 50)                                  | ■     | ■     | ■       | ■       | ■        |
|  WSB 80 Solder Bath                                                            | ■     | ■     | ■       | ■       | ■        |
|  WSB 150 Solder Bath                                                           | ■     | ■     |         |         | ■        |
|  WCB 2 Calibration Unit                                                        | ■     | ■     | ■       | ■       | ■        |

# Weller Multi-Digital Rework Station WMD 3 (With In-Built Pump)




Weller WMD 3 state-of-the-art technology simultaneously provides multi-digital control of working temperatures when reworking conventional ICs and SMDs.

A soldering iron, desoldering iron and hot air pencil can all be operated simultaneously because of the WMD 3's in-built micro-processor that infinitely controls each tool's set temperature and airflow. The display visually monitors each chosen working temperature and times preset hot gas pencil operations.

## Technical Data

|                                                        |                                                                                                                                                                                                                           |
|--------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Dimensions:                                            | 240 x 270 x 105 mm (W x D x H)                                                                                                                                                                                            |
| Line Voltage:                                          | 230 V, 50 Hz                                                                                                                                                                                                              |
| Power Input:                                           | 310 W                                                                                                                                                                                                                     |
| Safety Class:                                          | 1 and 3                                                                                                                                                                                                                   |
| Fuse:                                                  | T 1,5 A located at the power entry module                                                                                                                                                                                 |
| Controlling Tolerance:                                 | Soldering/Desoldering iron $\pm 2\%$ of the final value<br>Hot air pencil $\pm 30^{\circ}\text{C}$                                                                                                                        |
| Temperature Control with zero Voltage cross switching: | Soldering/Desoldering iron continuously $50^{\circ}\text{C}$ – $450^{\circ}\text{C}$ (WSP 150 $150^{\circ}\text{C}$ – $550^{\circ}\text{C}$ )<br>Hot air pencil continuously $50^{\circ}\text{C}$ – $550^{\circ}\text{C}$ |
| Pump:                                                  | Max. low pressure 0,7 bar; max. conveyance 20 l/min<br>Hot air: max. 10 l/min                                                                                                                                             |
| Potential Balance:                                     | Via 3,5 mm switch jack socket on the back of the unit                                                                                                                                                                     |

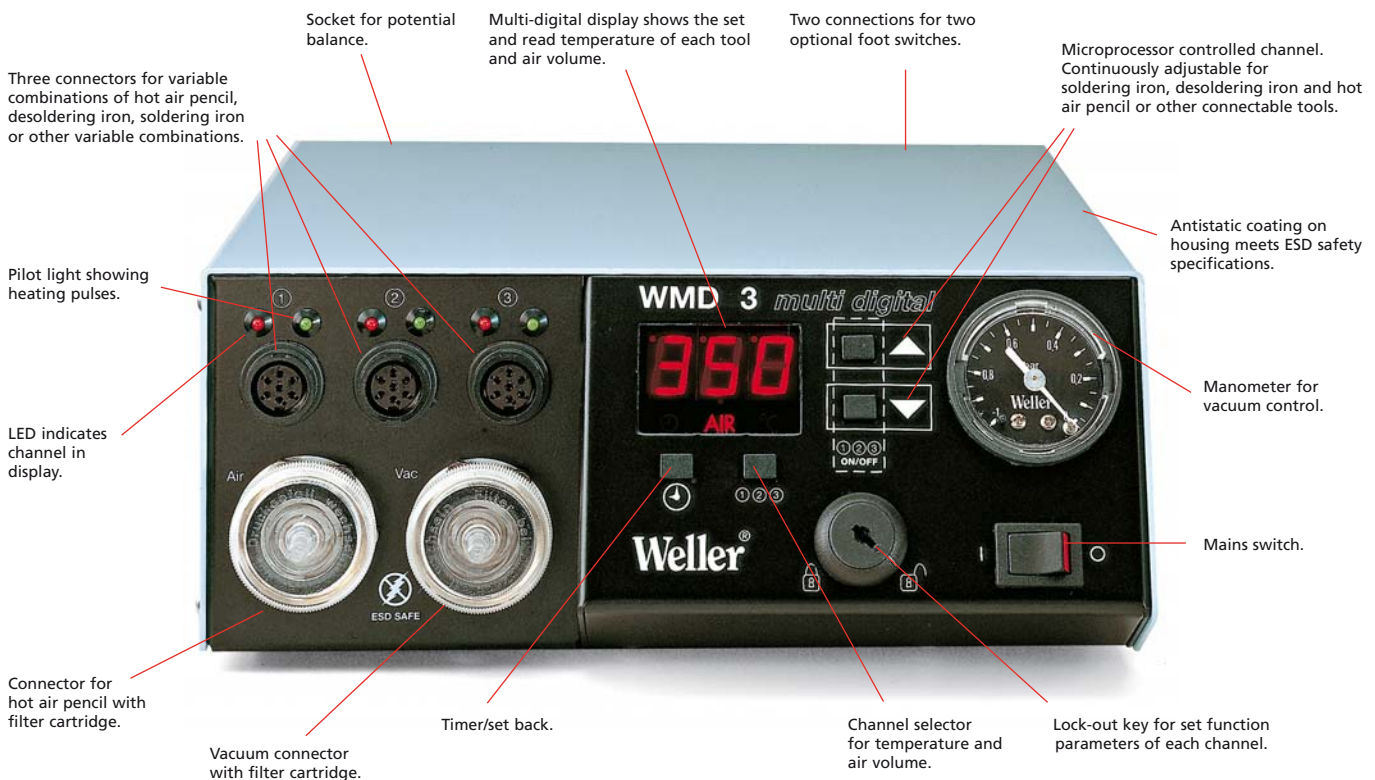

# Weller Multi-Digital Hot Air Station WMD 1A (With In-Built Pump)

Weller®

The multi application ability of this station makes it ideal for use in situations where the maximum amount of flexibility is required. The station has an in built pump to provide the air movement for the hot air pencil and the vacuum for the desoldering tool and can be used to rework both surface mounted and through hole components.

The WMD 1S control unit is the base and incorporates a micro processor controlled system to regulate the solder processes. The processor can also identify which tool is being used and calibrate the output automatically without the need for manual adjustment.

By use of the WCB 2 control box, additional functions can be programmed into the base unit such as, temperature lock, set back time, temperature offset, deg C/deg F, factory setting reset.

## Technical Data

|                                                        |                                                                                                  |
|--------------------------------------------------------|--------------------------------------------------------------------------------------------------|
| Dimensions:                                            | 240 x 270 x 105 mm (W x D x H)                                                                   |
| Line Voltage:                                          | 230 V, 50 Hz                                                                                     |
| Power Input:                                           | 175 W                                                                                            |
| Safety Class:                                          | 1 and 3                                                                                          |
| Fuse:                                                  | Glass tube fuse Ø 5 x 20; T 800 mA located at the power entry module                             |
| Controlling Tolerance:                                 | Soldering/Desoldering iron $\pm 2\%$ of the final value<br>Hot air pencil $\pm 30^\circ\text{C}$ |
| Temperature Control with zero Voltage cross switching: | Hot air pencil continuously $50^\circ\text{C}$ – $550^\circ\text{C}$                             |
| Pump:                                                  | Max. low pressure 0,7 bar; max. conveyance 20 l/min<br>Hot air: max. 10 l/min                    |
| Potential Balance:                                     | Via 3,5 mm switch jack socket on the back of the unit                                            |
| Foot switch connector:                                 | over adapter as accessories                                                                      |



# Weller Multi-Digital Desoldering Station WMD 1D (With In-Built Pump)

The multi application ability of this station makes it ideal for use in situations where the maximum amount of flexibility is required. The station has an in built pump to provide the vacuum for the desoldering tool and can be used to rework both surface mounted and through hole components.

The WMD 1S control unit is the base and incorporates a micro processor controlled system to regulate the

desolder processes. The processor can also identify which tool is being used and calibrate the output automatically without the need for manual adjustment.

By use of the WCB 2 control box, additional functions can be programmed into the base unit such as, temperature lock, set back time, temperature offset, deg C/deg F, factory setting reset.

## Technical Data

|                                                        |                                                                                                                                                                                                          |
|--------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Dimensions:                                            | 240 x 270 x 105 mm (W x D x H)                                                                                                                                                                           |
| Line Voltage:                                          | 230 V, 50 Hz                                                                                                                                                                                             |
| Power Input:                                           | 175 W                                                                                                                                                                                                    |
| Safety Class:                                          | 1 and 3                                                                                                                                                                                                  |
| Fuse:                                                  | Glass tube fuse Ø 5 x 20; T 800 mA located at the power entry module                                                                                                                                     |
| Controlling Tolerance:                                 | Soldering/Desoldering iron $\pm 2\%$ of the final value<br>Hot air pencil $\pm 30^{\circ}\text{C}$                                                                                                       |
| Temperature Control with zero Voltage cross switching: | Soldering/Desoldering iron continuously $50^{\circ}\text{C} - 450^{\circ}\text{C}$ , (WSP 150 $150^{\circ}\text{C} - 550^{\circ}\text{C}$ )<br>Hot air pencil $50^{\circ}\text{C} - 550^{\circ}\text{C}$ |
| Pump:                                                  | Max. low pressure 0,7 bar; max. conveyance 20 l/min<br>Hot air: max. 10 l/min                                                                                                                            |
| Potential Balance:                                     | Via 3,5 mm switch jack socket on the back of the unit                                                                                                                                                    |
| Foot switch connector:                                 | over adapter as accessories                                                                                                                                                                              |





# Weller Multi-Functional, Digital Desoldering Station WDD 161V

Weller®

The WDD 161V rework station is a dual output unit supplied with soldering and desoldering tools. It features a micro processor controlled system which allows independent temperature control of both tools. The station will automatically recognize the tool in use and calibrate itself for that tool. Vacuum for the desoldering tool is generated by an internal venturi driven from an external compressed air source.

The selected operating temperatures are displayed on a digital display switchable between tools. By use of the WCB 2 control box, additional functions can be pro-

grammed into the base unit such as, temperature lock, set back time, temperature offset, deg C/deg F, factory setting reset.



## Technical Data

|                            |                                                                         |
|----------------------------|-------------------------------------------------------------------------|
| Dimensions:                | 115 x 166 x 101 mm (W x D x H)                                          |
| Power Input:               | 165 W                                                                   |
| Temperature Control:       | Soldering/Desoldering iron continuously 50°C–450°C                      |
| Compressed Air:            | Inlet pressure 500 KPA–600 KPA (58–87 psi) oil-free, dry compressed air |
| Compressed Air Converter:  | Air consumption 35 l/min<br>Vacuum 55 KPA (8 psi)                       |
| Compressed Air Connection: | Compressed air hose of 6 mm (0.24") external diameter                   |
| Safety Class:              | 1 (control unit), 3 (soldering tool)                                    |
| Foot switch connector:     | over adapter as accessories                                             |

Multi-digital display shows the set and read temperature of DSX 80 or other connected tool.

Microprocessor controlled channel. Automatically recognizes the DSX 80 and other connected tools and sets the appropriate control parameters.

Antistatic coating on housing meets ESD safety specifications

Mains switch.

LED showing heating pulses.

Seven-pin connector for connecting the DSX and other soldering tools.

Connector for vacuum

Connector for potential balance

Holder AK 20 for DSX 80 desoldering iron.

Holder WPH 80 for soldering pencil WSP 80.

DSX 80 Desoldering iron.

Finger switch to control vacuum.

"Longlife" tiplets. Different interchangeable types available.

WSP 80 soldering pencil.



# Weller Multi-Functional, Digital Desoldering Station WDD 81V

The Weller WDD 81V Desoldering station features digital process control for exact temperature set. The in-built microprocessor circuitry automatically recognizes all Weller soldering irons and provides the optimal settings of the connected tool. The station comes with the DSX 80 Desoldering iron. A range of desoldering suction triplets enables solder to be removed from a wide variety of solder joints. The Weller CSF rework heads can also be

interchanged to provide total flexibility in the rework of most Flat Packs. An internal maintenance-free compressed air converter provides the vacuum for the desoldering iron. The WDD 81V requires a compressed air supply.

The Weller WCB 2 Calibration unit can be connected to the WDD 81V to further enhance programme setting or for PC interface.

## Technical Data

|                            |                                                                         |
|----------------------------|-------------------------------------------------------------------------|
| Dimensions:                | 115 x 166 x 101 mm (W x D x H)                                          |
| Power Input:               | 95 W                                                                    |
| Temperature Control:       | Soldering/Desoldering iron continuously 50°C–450°C                      |
| Compressed Air:            | Inlet pressure 500 KPA–600 KPA (58–87 psi) oil-free, dry compressed air |
| Compressed Air Converter:  | Air consumption 35 l/min                                                |
|                            | Vacuum 55 KPA (8 psi)                                                   |
| Compressed Air Connection: | Compressed air hose of 6 mm (0.24") external diameter                   |
| Safety Class:              | 1 (control unit), 3 (soldering tool)                                    |
| Foot switch connector:     | over adapter as accessories                                             |





## Weller Multi-Functional, Digital Hot Air Station WAD 101

**Weller®**

The Weller WAD 101 Hot air station features digital process control for accurate temperature set. The in-built microprocessor circuitry automatically recognizes all Weller soldering irons and provides the optimal settings of the connected tools as well as the HAP 1 that comes as standard with the station. A wide range of nozzles and tools makes the WAD 101 ideal in many soldering and desoldering applications of surface mount devices.

The WAD 101 requires a compressed air supply with oil-free, dry air or nitrogen (N<sub>2</sub>) where the airflow is manually controlled.

The Weller WCB 2 Calibration unit can be connected to the WAD 101 to further enhance programme setting or PC interface.

### Technical Data

|                            |                                                                                            |
|----------------------------|--------------------------------------------------------------------------------------------|
| Dimensions:                | 134 x 166 x 101 mm (W x D x H)                                                             |
| Power Input:               | 105 W                                                                                      |
| Temperature Control:       | Hot air pencil 50°C–550°C                                                                  |
| Flow Rate:                 | Approx. 0–10 l/min                                                                         |
| Compressed Air:            | Inlet pressure 400 KPA (58 psi) oil-free, dry compressed air or nitrogen (N <sub>2</sub> ) |
| Compressed Air Connection: | Compressed air hose of 6 mm (0,24") external diameter                                      |
| Safety Class:              | 1 (control unit), 3 (soldering tool)                                                       |
| Foot switch connector:     | over adapter as accessories                                                                |



### WSP 80IG Inert Gas Soldering Iron

#### for lead free soldering



For use in applications when soldering under an atmosphere of inert gas is required (prevention of joint oxidation). Driven from the WAD 101 station, inert gas is fed through the heating element of the iron to envelop the solder joint. The station controls the temperature of the iron and regulates the volume of gas supplied. The Stop + Go bench holder will automatically start the gas flow when the iron is removed from the holder and stop the gas flow when the iron is replaced.

#### The Set consists of:

- WSP 80 IG soldering iron with inert gas connection
- Stop+Go support WPH 81T
- Soldering tip LT B
- Connection hose: soldering iron – power unit (1.5 m)

#### Technical data WSP 80IG:

Temperature range: 50°C–450°C  
 Power: 80 W  
 Soldering tips model: LT series  
 Order No. 005 33 158 99

## Weller Flexibility.

Refer to the matrix to make your choice of connecting tools for the WMD 3, WMD 1A + D, WDD 161V, WDD 81V + VIL and WAD 101 (see matrix page 2).

### HAP 1 Hot air pencil

HAP 1  
005 33 114 99



The HAP 1, 100W/24V, provides a directional hot airflow that is adjustable and static-free. Electronically temperature controlled from 50°C to 550°C. Different nozzles available as accessories. Finger switch controls speed adjustable pump. Hot air pencil set, consisting of HAP 1 with finger switch, KH 27 Support for pencil, nozzle 1,2 and 3,0 mm, key and nutdriver for nozzle changing.

### DSX 80 Desoldering iron and service kit

DSX 80 (DS 80 UNC\*)  
005 33 138 99  
(005 13 191 99)



An 80W/24V desoldering iron for electronics rework. Electronically temperature controlled. Micro-finger switch controls quick-start, fast action vacuum pump. Different interchangeable tiplets, plus several CSF devices are available as accessories. DSX 80 set, consisting of DSX 80 Desoldering iron AK 20 Support, cleaning tool, glass collector, two desoldering nozzles, gasbet, anti-bloc paste, filter.

### DXV 80 Desoldering iron

DXV 80  
005 13 181 99



Connectable to all 80W desoldering stations. Handle utilizes the nonreturnable tin collector to hold the extracted solder. Use off thred less DX nozzles. DXV 80 set, consisting of DXV 80 Desoldering iron, and Support for iron.

### LR 21 Antistatic soldering pencil

LR 21  
005 33 112 99



Electronically temperature controlled 50W/24V soldering pencil. LR 21 set, consisting of LR 21 Antistatic soldering pencil, KH 20 Support for pencil.

### LR 82 Antistatic soldering iron

LR 82  
005 33 113 99



An 80W/24V soldering iron for high mass soldering. Dual sensor, electronically temperature controlled. LR 82 set, consisting of LR 82 Antistatic soldering iron, KH 27 Support for iron.

### WSP 80 Micro soldering pencil

WSP 80  
005 29 161 99



A micro soldering pencil, 80W/24V. This soldering pencil can be universally used in all situations from extremely delicate soldering to those where there is a greater temperature requirement. WSP 80 set, consisting of WSP 80 Micro soldering pencil with WPH 80 Support.

### WSP 80IG Inert Gas Soldering Iron

WSP 80IG  
005 33 158 99



For use in applications when soldering under an atmosphere of inert gas is required (prevention of joint oxidation). Driven from the WAD 101 station, inert gas is fed through the heating element of the iron to envelop the solder joint. The station controls the temperature of the iron and regulates the volume of gas supplied.

### WSP 150 Soldering iron

WSP 150  
005 33 135 99



The WSP 150, 150W/24V, soldering iron was specially developed for soldering tasks with extremely high heat requirements. The 150 W heater power combined with optimal transfer of heat to the soldering iron bit guarantee the high performance capability of the soldering iron. WSP 150 set, consisting of WSP 150 Soldering iron, KH 27 Support for iron.

## WST 20 Thermal wire stripper with support

WST 20  
005 25 030 99



The WST 20, 50W/24V, copes with all known thermoelastic plastics. Adjustable for a stripping length up to 30 mm. Additional blades available for stripping flat cables and shrinking.

## WST 82 Thermal wire stripper with support

The WST 82 is the 80 W equipment of the WST 20. Adjustable for a stripping length up to 30 mm. Additional blades available for stripping flat cables and shrinking.

## MPR 80 Antistatic Peritronic soldering pencil

MPR 80  
005 33 131 99



An 80W Antistatic Peritronic soldering pencil that gives all-round vision when making intricate connections. Anti-static cord and handle. Electronically temperature controlled. Consists of MPR 80 Antistatic and KH 25P Support.

## WMP Micro soldering pencil

WMP  
005 33 155 99



The 65W micro pencil is up to the task with superior performance for both heat-up and thermal efficiency. Suitable to handle all micro components and fine pitch tasks. The WMP provides an extremely short tip-to-grip distance. The heater is integrated into the handle. When the tip wear out the heating element goes on. WMP set consisting of WMP micro soldering pencil and WPHM holder for WMP.

## WHP 80 (80W/24V) Preheating plate

WHP 80  
005 27 028 99



With a heating surface of 80 x 50 mm, they preheat IC boards prior to micro rework.

## WTA 50 Tweezer

WTA 50  
005 33 133 99



This tweezer is used to desolder SMD components. The tweezer has two moveable heating elements. WTA 50 set, consisting of WTA 50 Tweezer, AK 51 Support for Tweezer.

## WSB 80 Solder bath


WSB 80  
005 27 040 99



The WSB 80 is a very useful rework preparation tool. The solder bath is temperature controlled continuously from 50°C to 450°C via an existing 80W power source. The solder bath can be used to tin wire ends and clean leads of all extraneous solder particles in preparation for reworking. (Usable for lead free solder.)

## WSB 150 Solder bath

WSB 150  
005 27 042 99

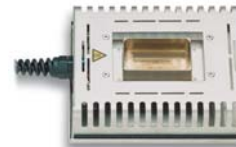

The WSB 150 solder bath is optimally suited to tin coating and preparation of soldering components. It has a temperature range of 50°C–550°C with heat output of 150W, making the WSB solder bath an ideal accessory to the Weller WSD 150 soldering station. To guard against dripping solder residue, the solder bath is placed in a V2A tray, supplied as an optional extra. (Usable for lead free solder.)

## WCB 2 Calibration unit

WCB 2  
005 31 180 99




The intelligence of the digital Weller units can be further enhanced by being programmed by the WCB 2 Calibration unit. The WCB 2 feature temperature lock-out and off-set capabilities up to +40°C. The WCB 2 has the added ability to PC interface (RS 232) and a thermoelement type K and measuring tip.



# CSF Accessories

for DS 80 (DS 80UNC), DSX 80, DSV 80 (DSV 80UNC), DSXV 80, DXV 80 and DSVT 80  
for SMD's chip desoldering triplets for flat packs

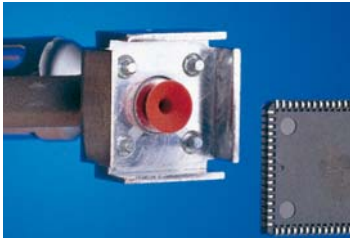

DS 80 (DS 80UNC),  
DSX 80








DSV 80 (DSV 80UNC),  
DSXV 80, DXV 80




DXV 80

## CSF-Q

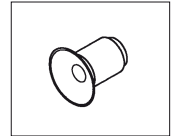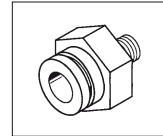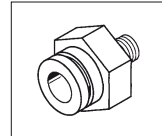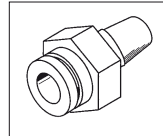

| $x_1$ (mm) x $y_1$ (mm)<br>$x_1 > x + 0,3$<br>$y_1 > y + 0,3$ | CSF-Head<br>Order No. | Adaptor<br>$\varnothing$ | Adaptor for<br>DSX 80,<br>DSXV 80 | Adaptor for<br>DS 80,<br>DSV 80 | Adaptor for<br>DS 80UNC,<br>DSV 80UNC | Rubber insert<br>(square) |
|---------------------------------------------------------------|-----------------------|--------------------------|-----------------------------------|---------------------------------|---------------------------------------|---------------------------|
| 12,0 x 12,0                                                   | 005 87 417 33         | 6                        | 005 87 418 03                     | 005 87 417 15                   | 005 87 417 88                         | 005 87 137 99             |
| 12,0 x 14,5                                                   | 005 87 417 34         | 6                        | 005 87 418 03                     | 005 87 417 15                   | 005 87 417 88                         | 005 87 137 99             |
| 12,7 x 12,7                                                   | 005 87 417 35         | 6                        | 005 87 418 03                     | 005 87 417 15                   | 005 87 417 88                         | 005 87 137 99             |
| 17,0 x 17,0                                                   | 005 87 417 36         | 11                       | 005 87 418 04                     | 005 87 417 16                   | 005 87 417 89                         | 005 87 137 98             |
| 17,0 x 23,0                                                   | 005 87 417 37         | 16                       | 005 87 418 05                     | 005 87 417 17                   | 005 87 417 90                         | 005 87 137 98             |
| 19,6 x 19,6                                                   | 005 87 417 38         | 11                       | 005 87 418 04                     | 005 87 417 16                   | 005 87 417 89                         | 005 87 137 98             |

## CSF-QI

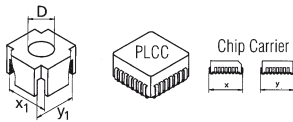

|             |               |    |               |               |               |               |
|-------------|---------------|----|---------------|---------------|---------------|---------------|
| 12,7 x 12,7 | 005 87 417 39 | 6  | 005 87 418 03 | 005 87 417 15 | 005 87 417 88 | 005 87 137 99 |
| 17,8 x 17,8 | 005 87 417 40 | 11 | 005 87 418 04 | 005 87 417 16 | 005 87 417 89 | 005 87 137 98 |
| 20,4 x 20,4 | 005 87 417 41 | 16 | 005 87 418 05 | 005 87 417 17 | 005 87 417 90 | 005 87 137 98 |
| 25,4 x 25,4 | 005 87 417 42 | 16 | 005 87 418 05 | 005 87 417 17 | 005 87 417 90 | 005 87 137 98 |
| 30,4 x 30,4 | 005 87 417 43 | 16 | 005 87 418 05 | 005 87 417 17 | 005 87 417 90 | 005 87 137 98 |

## CSF-D



|             |               |    |               |               |               |               |
|-------------|---------------|----|---------------|---------------|---------------|---------------|
| 5,5 x 10,0  | 005 87 417 23 | 6  | 005 87 418 03 | 005 87 417 15 | 005 87 417 88 | 005 87 137 99 |
| 5,8 x 10,5  | 005 87 417 24 | 6  | 005 87 418 03 | 005 87 417 15 | 005 87 417 88 | 005 87 137 99 |
| 6,7 x 10,0  | 005 87 417 25 | 6  | 005 87 418 03 | 005 87 417 15 | 005 87 417 88 | 005 87 137 99 |
| 9,3 x 13,0  | 005 87 417 26 | 6  | 005 87 418 03 | 005 87 417 15 | 005 87 417 88 | 005 87 137 99 |
| 9,4 x 10,0  | 005 87 417 27 | 6  | 005 87 418 03 | 005 87 417 15 | 005 87 417 88 | 005 87 137 99 |
| 9,8 x 18,0  | 005 87 417 28 | 6  | 005 87 418 03 | 005 87 417 15 | 005 87 417 88 | 005 87 137 99 |
| 10,0 x 16,0 | 005 87 417 29 | 6  | 005 87 418 03 | 005 87 417 15 | 005 87 417 88 | 005 87 137 99 |
| 10,5 x 16,0 | 005 87 417 30 | 6  | 005 87 418 03 | 005 87 417 15 | 005 87 417 88 | 005 87 137 99 |
| 10,7 x 18,0 | 005 87 417 31 | 6  | 005 87 418 03 | 005 87 417 15 | 005 87 417 88 | 005 87 137 99 |
| 11,0 x 26,5 | 005 87 417 32 | 11 | 005 87 418 04 | 005 87 417 16 | 005 87 417 89 | 005 87 137 98 |

## CSF-DI



|            |               |   |               |               |               |               |
|------------|---------------|---|---------------|---------------|---------------|---------------|
| 9,0 x 18,0 | 005 87 417 44 | 6 | 005 87 418 03 | 005 87 417 15 | 005 87 417 88 | 005 87 137 99 |
|------------|---------------|---|---------------|---------------|---------------|---------------|

## Accessories

For easier rework and repair, Weller has a large range of desoldering nozzles and soldering nozzles.

### Threadless nozzles for desoldering iron DSX 80, DSXV 80 and DXV 80

The new X series nozzle feature a threadless fixture system whereby the nozzle is inserted into the head and locked into place by applying a 1/4 turn. This feature allows the nozzles to be quickly and easily exchanged and also improves the rate of thermal transfer from the head to the nozzle.



DSX 80




DSXV 80



DXV 80


### Nozzles for desoldering iron DSX 80, DSXV 80 and DXV 80



|  | Model            | Description                                                                                                             | mm  | mm   | mm   | Order No.     |
|--|------------------|-------------------------------------------------------------------------------------------------------------------------|-----|------|------|---------------|
|  | DX110            | Nozzle                                                                                                                  | 1,9 | 0,7  | 23   | 005 13 140 00 |
|  | DX111            | Nozzle                                                                                                                  | 2,5 | 0,7  | 23   | 005 13 141 00 |
|  | DX112            | Nozzle                                                                                                                  | 2,3 | 1,0  | 23   | 005 13 142 00 |
|  | DX113            | Nozzle                                                                                                                  | 2,5 | 1,2  | 23   | 005 13 143 00 |
|  | DX113HM          | Nozzle<br>with improved thermal transfer                                                                                | 2,5 | 1,2  | 23   | 005 13 150 00 |
|  | DX114            | Nozzle                                                                                                                  | 3,3 | 1,8  | 23   | 005 13 144 00 |
|  | DX115            | Nozzle                                                                                                                  | 1,9 | 0,7  | 23   | 005 13 145 00 |
|  | DX116            | Nozzle                                                                                                                  | 2,7 | 1,2  | 29   | 005 13 146 00 |
|  | DX117            | Nozzle                                                                                                                  | 2,9 | 1,5  | 23   | 005 13 147 00 |
|  | DX118            | Nozzle                                                                                                                  | 1.5 | 0.7  | 23   | 005 13 148 00 |
|  | DX119            | Needle Tiplet<br>with not wettable stainless steel tube for removal of solder bridges in connection with hot air pencil | 1,1 | 0,7  | 31   | 005 13 151 00 |
|  | DX120            | Nozzle<br>without inside tube, for cleaning of SMD pads                                                                 | 2,5 | 1,1  | 22   | 005 13 152 00 |
|  | Measuring Nozzle | for temperature measurement with thermocouple 0.5                                                                       | 3,3 | 0,55 | 21,5 | 005 13 153 99 |
|  | Conus insert     | cleaning tool                                                                                                           |     |      |      | 005 87 067 94 |
|  | Nozzle Set       | DX 110-DX115                                                                                                            |     |      |      | 005 13 790 99 |

# Hot Air Nozzles

for hot air pencil HAP 1



|  |  | Description                                        | Dimensions (mm)<br>x y | Type    | Order No.     |
|--|--|----------------------------------------------------|------------------------|---------|---------------|
|  |  | Hot air nozzle                                     | 18,0 x 18,0            | Q10     | 005 87 277 85 |
|  |  | four sides heated                                  | 16,0 x 16,0            | SK 769A | 005 87 278 16 |
|  |  | with hot plate                                     | 12,0 x 12,0            | SK 709A | 005 87 278 12 |
|  |  | Hot air nozzle                                     | 12,5 x 15,0            | Q08     | 005 87 277 83 |
|  |  | Hot air nozzle                                     | 15,0 x 10,0            | Q06     | 005 87 277 80 |
|  |  | Hot air nozzle                                     | 6,0 x 9,0              | Q04     | 005 87 277 78 |
|  |  | Hot air nozzle                                     | 6,0 x 6,5              | Q02     | 005 87 277 77 |
|  |  | Hot air nozzles                                    | 10,0 x 18,0            | D10     | 005 87 277 84 |
|  |  | Hot air nozzle                                     | 15,0 x 10,0            | D08     | 005 87 277 81 |
|  |  | Hot air nozzle                                     | 10,0 x 13,0            | D06     | 005 87 277 82 |
|  |  | Hot air nozzle                                     | 10,5 x 10,5            | D04     | 005 87 277 79 |
|  |  | Measuring nozzle<br>for thermo element<br>Ø 0,5 mm | –                      | R01     | 005 87 278 08 |










# Hot Air Nozzles

for hot air pencil HAP 1

Weller®













|                                                                                     |  | Description                   | Dimensions (mm) | Type | Order No.     |
|-------------------------------------------------------------------------------------|--|-------------------------------|-----------------|------|---------------|
|    |  | Flat nozzle                   | 12,0 x 1,5      | F06  | 005 87 277 72 |
|    |  | Flat nozzle                   | 10,5 x 1,5      | F04  | 005 87 277 73 |
|   |  | Flat nozzle                   | 8,0 x 1,5       | F02  | 005 87 277 74 |
|  |  | Round nozzle<br>long straight | Ø 2,0           | R10  | 005 87 277 87 |
|  |  | Round nozzle<br>long bent     | Ø 2,0           | R08  | 005 87 277 86 |
|  |  | Round nozzle                  | Ø 3,0           | R06  | 005 87 278 22 |
|  |  | Round nozzle                  | Ø 1,2           | R04  | 005 87 278 21 |
|  |  | Round nozzle                  | Ø 0,8           | R02  | 005 87 278 23 |
|  |  | Dual nozzle                   | Ø 1,5 x 10,0    | FD4  | 005 87 277 75 |
|  |  | Dual nozzle                   | Ø 1,5 x 8,0     | FD2  | 005 87 277 76 |

# Soldering Tips

for soldering iron LR 82






|                                                                                     | Description                                       | Width A             | Thickness B | Type  | Order No.     |
|-------------------------------------------------------------------------------------|---------------------------------------------------|---------------------|-------------|-------|---------------|
|    | Chisel                                            | 3,2 mm              | 1,0 mm      | HT 1  | 005 44 260 99 |
|    | Chisel                                            | 5,2 mm              | 1,2 mm      | HT 2  | 005 44 261 99 |
|   | Chisel                                            | 7,0 mm              | 1,2 mm      | HT 3  | 005 44 262 99 |
|  | Chisel long                                       | 3,2 mm              | 1,0 mm      | HT C  | 005 44 267 99 |
|  | Chisel long                                       | 4,6 mm              | 1,0 mm      | HT D  | 005 44 268 99 |
|  | Chisel long                                       | 5,6 mm              | 1,0 mm      | HT E  | 005 44 269 99 |
|  | Round                                             | 2,4 mm              | 8,3 mm      | HT BS | 005 44 264 99 |
|  | Round                                             | 3,2 mm              | 8,3 mm      | HT CS | 005 44 265 99 |
|  | Round                                             | 5,0 mm              | 8,3 mm      | HT DS | 005 44 266 99 |
|  | Measuring tip<br>for thermo element –<br>Ø 0,5 mm | –                   | –           | –     | 005 44 263 99 |
|  | Screw in tip                                      | with M8 outerthread |             |       | 005 44 270 99 |

# Soldering Tips

for soldering pencil LR 21

Weller®

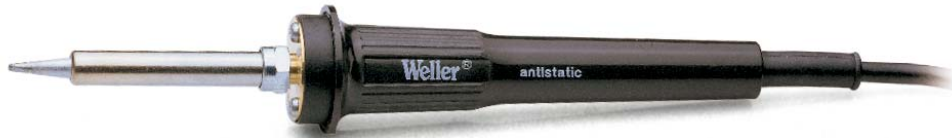



|                                                                                     | Description                                        | Width                       | Type   | Order No. for regular solder |
|-------------------------------------------------------------------------------------|----------------------------------------------------|-----------------------------|--------|------------------------------|
|    | Chisel                                             | 0,8 mm                      | ET H   | 4 ET H                       |
|                                                                                     |                                                    | 1,6 mm                      | ET A   | 4 ET A                       |
|                                                                                     |                                                    | 2,4 mm                      | ET B   | 4 ET B                       |
|                                                                                     |                                                    | 3,2 mm                      | ET C   | 4 ET C                       |
|                                                                                     |                                                    | 4,6 mm                      | ET D   | 4 ET D                       |
|                                                                                     |                                                    | 5,6 mm                      | ET E   | 4 ET E                       |
|    | Chisel long                                        | 1,2 mm                      | ET K   | 4 ET K                       |
|                                                                                     |                                                    | 2,0 mm                      | ET L   | 4 ET L                       |
|                                                                                     |                                                    | 3,2 mm                      | ET M   | 4 ET M                       |
|  | Round tip, blunt                                   | 0,8 mm                      | ET P   | 4 ET P                       |
|                                                                                     |                                                    | 2,4 mm                      | ET BS  | 4 ET BS                      |
|                                                                                     |                                                    | 3,2 mm                      | ET CS  | 4 ET CS                      |
|  | Round fine long                                    | 0,8 mm                      | ET O   | 4 ET O                       |
|                                                                                     |                                                    | 0,4 mm                      | ET S   | 4 ET S                       |
|  | Chisel slim                                        | 1,6 mm                      | ET R   | 4 ET R                       |
|  | Round stopped 45°                                  | 1,2 mm                      | ET F   | 4 ET F                       |
|                                                                                     |                                                    | 2,4 mm                      | ET BB  | 4 ET BB                      |
|                                                                                     |                                                    | 3,2 mm                      | ET CC  | 4 ET CC                      |
|  | Chip soldering/<br>desoldering tip                 | 2,5 x 1,5 mm                | ET SMD | 005 41 039 99                |
|                                                                                     |                                                    | 3,8 x 1,5 mm                | ET SMD | 005 41 040 99                |
|  | Gull wing                                          | –                           | ET GW  | 005 41 045 99                |
|  | ET Measuring tip<br>for thermo element<br>Ø 0,5 mm | –                           | –      | 005 24 750 99                |
|  | Screw in tip                                       | with M5 outerthread         |        | 005 41 703 99                |
|  | ET - LT Adapter                                    | for use LR21 LT series tips |        | 005 87 207 81                |

If any other tips are required, use LT tips with ET/LT adapter.

# Soldering Tips

for soldering pencil MLR 21



|                                                                                     | Description                                  | Width                              | Type                            | Order No.                                       |
|-------------------------------------------------------------------------------------|----------------------------------------------|------------------------------------|---------------------------------|-------------------------------------------------|
|    | Micropoint                                   | 0,25 mm                            | MT 1                            | 005 44 101 99                                   |
|    | Micropoint slim                              | 0,25 mm                            | MT 15                           | 005 44 105 99                                   |
|  | Chisel slim                                  | 1,6 mm                             | MT 6                            | 005 44 106 99                                   |
|  | Sloped                                       | 1,2 mm                             | MT 4                            | 005 44 104 99                                   |
|  | Chisel                                       | 0,8 mm<br>1,6 mm<br>2,4 mm         | MT H<br>MT A<br>MT B            | 005 44 112 99<br>005 44 110 99<br>005 44 111 99 |
|  | Chisel bent                                  | 0,8 mm                             | MT HX*<br>*only with barrel nut | 005 44 113 99<br>005 87 207 01                  |
|  | Gull wing                                    | Ø 2,0 mm                           | MT GW                           | 005 44 119 99                                   |
|  | Measuring tip for thermo element<br>Ø 0,5 mm | –                                  | –                               | 005 44 114 99                                   |
|  | MT - LT Adapter                              | for use MLR 21 with LT series tips |                                 | 005 44 121 99                                   |

If any other tips are required, use LT tips with MT/LT adapter.




# Soldering Tips

for micro soldering pencil WMP

Weller®



NT-Tip



|  | Description           | Width A | Thickness B | Length C | Type/Order No. |
|--|-----------------------|---------|-------------|----------|----------------|
|  | Chisel tip            | 0,8 mm  | 0,4 mm      | 8,4 mm   | NTH            |
|  |                       | 1,2 mm  | 0,4 mm      | 8,4 mm   | NTK            |
|  |                       | 1,6 mm  | 0,4 mm      | 8,4 mm   | NTA            |
|  |                       | 1,6 mm  | 0,4 mm      | 9,5 mm   | NT6            |
|  |                       | 2,4 mm  | 0,8 mm      | 7,4 mm   | NTB            |
|  |                       | 3,2 mm  | 0,8 mm      | 7,8 mm   | NTC            |
|  |                       | 4,0 mm  | 0,8 mm      | 7,8 mm   | NTD            |
|  | Chisel tip, bent      | 0,4 mm  | 1,6 mm      | 8,2 mm   | NTAX           |
|  | Round tip, bent       | 1,6 mm  | 0,8 mm      | 8,6 mm   | NT1X           |
|  | Round tip             | 0,25 mm | –           | 7,4 mm   | NT1            |
|  | Round tip slim        | 0,25 mm | –           | 8,5 mm   | NT1S           |
|  | Round tip, sloped 45° | 1,2 mm  | –           | 9,9 mm   | NT4            |
|  | Gull wing             | 2,0 mm  | 3,0 mm      | 13,4 mm  | NTGW           |
|  | NT Measuring tip      | –       | –           | –        | NTMS           |

# Soldering Tips

for WSP 80, WSP 80IG, WSP 80FE and MPR 80



WSP 80 (FE)



MPR 80

|  | Description             | Width A   | Thickness B | Length  | Type    | Order No.     |
|--|-------------------------|-----------|-------------|---------|---------|---------------|
|  | Chisel                  | 0,8 mm    | 0,4 mm      | 11,5 mm | LT H    | 005 44 437 99 |
|  | Chisel*                 | 0,8 mm    | 0,4 mm      | 11,5 mm | LT HHPB | 005 44 430 99 |
|  | Chisel                  | 1,6 mm    | 0,7 mm      | 11,5 mm | LT A    | 005 44 440 00 |
|  | Chisel*                 | 1,6 mm    | 0,7 mm      | 11,5 mm | LT AHPB | 005 44 431 99 |
|  | Chisel**                | 1,6 mm    | 0,7 mm      | 11,5 mm | LT ALF  | 005 44 470 00 |
|  | Chisel                  | 2,4 mm    | 0,8 mm      | 11,5 mm | LT B    | 005 44 405 00 |
|  | Chisel*                 | 2,4 mm    | 0,8 mm      | 11,5 mm | LT BHPB | 005 44 432 99 |
|  | Chisel**                | 2,4 mm    | 0,8 mm      | 11,5 mm | LT BLF  | 005 44 446 00 |
|  | Chisel                  | 3,2 mm    | 0,8 mm      | 11,5 mm | LT C    | 005 44 407 00 |
|  | Chisel**                | 3,2 mm    | 0,8 mm      | 11,5 mm | LT CLF  | 005 44 447 00 |
|  | Chisel                  | 4,6 mm    | 0,8 mm      | 11,5 mm | LT D    | 005 44 409 99 |
|  | Chisel**                | 4,6 mm    | 0,8 mm      | 11,5 mm | LT DLF  | 005 44 448 00 |
|  | Chisel*                 | 4,6 mm    | 0,8 mm      | 11,5 mm | LT DHPB | 005 44 483 00 |
|  | Chisel long             | 1,2 mm    | 0,4 mm      | 19,0 mm | LT K    | 005 44 438 00 |
|  | Chisel long             | 2,0 mm    | 1,0 mm      | 19,0 mm | LT L    | 005 44 414 00 |
|  | Chisel long**           | 2,0 mm    | 1,0 mm      | 19,0 mm | LT LLF  | 005 44 476 00 |
|  | Chisel long             | 3,2 mm    | 1,2 mm      | 19,0 mm | LT M    | 005 44 415 00 |
|  | Chisel long**           | 3,2 mm    | 1,2 mm      | 19,0 mm | LT MLF  | 005 44 477 00 |
|  | Chisel bent             | 0,8 mm    | 0,4 mm      | 16,5 mm | LT HX   | 005 44 420 99 |
|  | Chisel bent             | 1,6 mm    | 0,7 mm      | 16,5 mm | LT ALX  | 005 44 443 00 |
|  | Chisel bent             | 2,4 mm    | 0,8 mm      | 16,5 mm | LT BX   | 005 44 442 00 |
|  | Chisel bent**           | 3,2 mm    | 0,8 mm      | 16,5 mm | LT MXLF | 005 44 469 00 |
|  | Chisel bent             | 1,6 mm    | 0,8 mm      | 12,5 mm | LT AX   | 005 44 427 00 |
|  | Chisel bent**           | 1,6 mm    | 0,8 mm      | 12,5 mm | LT AXLF | 005 44 480 00 |
|  | Round slim              | Ø 0,2 mm  | 1,6 mm      | 13,0 mm | LT 1S   | 005 44 436 99 |
|  | Round                   | Ø 0,25 mm |             | 12,0 mm | LT 1    | 005 44 435 99 |
|  | Round                   | Ø 1,6 mm  |             | 12,0 mm | LT AS   | 005 44 404 00 |
|  | Round**                 | Ø 1,6 mm  |             | 12,0 mm | LT ASLF | 005 44 471 00 |
|  | Round                   | Ø 3,2 mm  |             | 12,0 mm | LT CS   | 005 44 411 00 |
|  | Round**                 | Ø 3,2 mm  |             | 12,0 mm | LT CSLF | 005 44 474 00 |
|  | Round slim bent         | Ø 2,0 mm  | Ø 0,4 mm    | 20,5 mm | LT 1SLX | 005 44 426 99 |
|  | Round bent 30°          | Ø 1,2 mm  |             | 15,0 mm | LT 4X   | 005 44 428 00 |
|  | Round bent 30°          | Ø 0,4 mm  |             | 11,0 mm | LT 1X   | 005 44 425 99 |
|  | Round sloped 45° slim   | Ø 1,2 mm  |             | 13,5 mm | LT 4    | 005 44 439 99 |
|  | Round sloped 45°        | Ø 1,2 mm  |             | 11,0 mm | LT F    | 005 44 408 00 |
|  | Round sloped 45° long   | 1,6 mm    | 4,0 mm      | 16,5 mm | LT AALF | 005 44 487 00 |
|  | Round sloped 45° long   | 2,4 mm    | 4,0 mm      | 16,5 mm | LT BB   | 005 44 444 00 |
|  | Round sloped 45° long** | 2,4 mm    | 4,0 mm      | 17,0 mm | LT BBLF | 005 44 472 00 |
|  | Round sloped 45° long   | 3,2 mm    | 6,0 mm      | 16,0 mm | LT CC   | 005 44 445 00 |
|  | Round sloped 45° long** | 3,2 mm    | 6,0 mm      | 16,2 mm | LT CCLF | 005 44 473 00 |
|  | Round sloped 45° long** | 4,6 mm    | 6,0 mm      | 19,0 mm | LT DDLF | 005 44 478 00 |

# Soldering Tips

for WSP 80, WSP 80IG, WSP 80FE and MPR 80

Weller®



WSP 80 (FE)



MPR 80

|  | Description                                     | Width A  | Thickness B | Length  | Type    | Order No.     |
|--|-------------------------------------------------|----------|-------------|---------|---------|---------------|
|  | Conical long                                    | Ø 0,2 mm |             | 19,0 mm | LT 1L   | 005 44 423 99 |
|  | Conical long                                    | Ø 0,4 mm |             | 19,0 mm | LT S    | 005 44 406 99 |
|  | Conical long**                                  | Ø 0,6 mm |             | 19,0 mm | LT TLF  | 005 44 482 00 |
|  | Conical long**                                  | Ø 1,0 mm |             | 19,0 mm | LT OLF  | 005 44 492 00 |
|  | Conical long bent                               | Ø 0,2 mm |             | 24,0 mm | LT 1LX  | 005 44 424 99 |
|  | Gull wing 45°                                   | Ø 2,3 mm | 3,2 mm      | 17,0 mm | LT GW   | 005 44 410 00 |
|  | Gull wing 45°**                                 | Ø 2,3 mm | 3,2 mm      | 17,0 mm | LT GWLF | 005 44 475 00 |
|  | Knife tip**                                     | 6,2 mm   |             | 16,0 mm | LT KNLF | 005 44 479 00 |
|  | LT Measuring tip<br>for thermo element Ø 0,5 mm |          |             |         |         | 005 44 416 00 |
|  | LT Screw in tip with M4 thread                  |          |             |         |         | 005 44 449 99 |

\* **HPB solder** = solder with high consumption of lead for special applications

\*\* **Lead free solder** = the LF soldering tips have thicker layer of iron. This improves the lifetime and makes them ideal for working with lead free solder. Regular soldering tips can be used with lead free solder but it reduces their lifetime for physical reasons.

## SMT soldering tip for reworks on SMT components

|  | Description | Width A | Thickness B | Length C | Type     | Order No. |
|--|-------------|---------|-------------|----------|----------|-----------|
|  | Blade       | 10,4 mm | 0,6 mm      | 7,1 mm   | LT SMT01 | LTSMT01   |
|  | Blade       | 16,8 mm | 0,6 mm      | 7,1 mm   | LT SMT02 | LTSMT02   |
|  | Blade       | 20,8 mm | 0,6 mm      | 7,1 mm   | LT SMT03 | LTSMT03   |
|  | Slot        | 1,8 mm  | 3,4 mm      | 1,8 mm   | LT SMT04 | LTSMT04   |
|  | Slot        | 1,5 mm  | 2,3 mm      | 1,8 mm   | LT SMT05 | LTSMT05   |
|  | Slot        | 2,5 mm  | 1,7 mm      | 1,4 mm   | LT SMT06 | LTSMT06   |
|  | Slot        | 2,3 mm  | 4,5 mm      | 1,8 mm   | LT SMT07 | LTSMT07   |
|  | Tunnel      | 4,6 mm  | 5,1 mm      | 2,3 mm   | LT SMT08 | LTSMT08   |
|  | Tunnel      | 10,4 mm | 5,1 mm      | 2,3 mm   | LT SMT09 | LTSMT09   |
|  | Tunnel      | 11,5 mm | 6,9 mm      | 2,3 mm   | LT SMT10 | LTSMT10   |
|  | Tunnel      | 13,2 mm | 9,5 mm      | 3,2 mm   | LT SMT11 | LTSMT11   |
|  | Tunnel      | 15,8 mm | 9,5 mm      | 3,2 mm   | LT SMT12 | LTSMT12   |
|  | Tunnel      | 18,3 mm | 9,5 mm      | 3,2 mm   | LT SMT13 | LTSMT13   |
|  | Tunnel      | 18,8 mm | 9,0 mm      | 3,2 mm   | LT SMT14 | LTSMT14   |
|  | Quad        | 2,7 mm  | 7,7 mm      | 3,8 mm   | LT SMT15 | LTSMT15   |
|  | Quad        | 10,4 mm | 10,4 mm     | 3,8 mm   | LT SMT16 | LTSMT16   |
|  | Quad        | 12,7 mm | 12,7 mm     | 3,8 mm   | LT SMT17 | LTSMT17   |
|  | Quad        | 13,7 mm | 8,6 mm      | 3,8 mm   | LT SMT18 | LTSMT18   |
|  | Quad        | 19,1 mm | 19,1 mm     | 3,8 mm   | LT SMT19 | LTSMT19   |
|  | Quad        | 23,2 mm | 17,3 mm     | 3,8 mm   | LT SMT20 | LTSMT20   |
|  | Quad        | 24,5 mm | 24,5 mm     | 3,8 mm   | LT SMT21 | LTSMT21   |
|  | Quad        | 29,6 mm | 29,6 mm     | 3,8 mm   | LT SMT22 | LTSMT22   |

## Soldering Tips



WSP 150



WTA 50

### For soldering iron WSP 150

|  | Description                                         | Width A | Thickness B | Type    | Order No.     |
|--|-----------------------------------------------------|---------|-------------|---------|---------------|
|  | Chisel                                              | 3,2 mm  | 1,2 mm      | LHT C   | 005 44 455 99 |
|  |                                                     | 4,7 mm  | 1,8 mm      | LHT D   | 005 44 452 99 |
|  |                                                     | 6,7 mm  | 1,8 mm      | LHT E   | 005 44 451 99 |
|  |                                                     | 9,3 mm  | 1,8 mm      | LHT F   | 005 44 450 99 |
|  | Chisel bent                                         | 5 mm    | 2 mm        | LHT DX  | 005 44 462 99 |
|  |                                                     | 7 mm    | 2 mm        | LHT EX  | 005 44 461 99 |
|  |                                                     | 10 mm   | 2 mm        | LHT FX  | 005 44 460 99 |
|  | Sloped 45°<br>for solar panel<br>production         | –       | –           | LHT D45 | 005 44 456 00 |
|  | LHT Measuring tip<br>for thermo element<br>Ø 0,5 mm | –       | –           | –       | 005 44 453 99 |

### For WT 50 and WTA 50 tweezer

|  |                      |         |        |        |               |
|--|----------------------|---------|--------|--------|---------------|
|  | Tip set bent 45°     | 0,5 mm  | 0,5 mm | WTA 1S | 005 44 145 99 |
|  | Tip set bent 45°     | 1,0 mm  | 0,5 mm | WTA 1  | 005 44 141 99 |
|  | Tip set bent 45°     | 3,0 mm  | 0,5 mm | WTA 2  | 005 44 146 99 |
|  | Tip set bent 45°     | 6,0 mm  | 0,5 mm | WTA 3  | 005 44 147 99 |
|  | Tip set              | 12,5 mm | 0,5 mm | WTA 4  | 005 44 143 99 |
|  | Tip set              | 18,5 mm | 0,5 mm | WTA 5  | 005 44 144 99 |
|  | Tip set vertical use | 1,0 mm  | 0,5 mm | WTA 11 | 005 44 152 99 |
|  | Tip set vertical use | 3,0 mm  | 0,5 mm | WTA 12 | 005 44 153 99 |



## Additional Safety Rests

### Safety rests with Stop+Go Function

The safety rests with Stop+Go function have an integrated micro switch which is activated when the soldering iron is picked up or put down. The operator can decide between an immediate or delayed (20 min) temperature reduction (SETBACK) to 150°C (300°F) and programme the power unit accordingly. The SETBACK time can be changed with the optional calibration box WCB 2. The temperature reduction extends the lifetime of the tips.

When working with the inert gas soldering iron WSP 80IG together with the hot air station WAD 101 the Stop+Go safety rest will start and stop the inert gas flow.

All Weller digital soldering stations and the WAD 101 hot air station automatically recognize the Stop+Go safety rests.



#### WPHT (WPHT)

Safety rests with Stop+Go Function for WMP

#### WPH 81T (005 15 144 99)

Safety rests with Stop+Go Function for WSP 80, WSP 80IG und MPR 80

### Standard Safety rests

complete with sponge

#### AK 1 (005 15 010 99)



Support for DSX 80 (DS 80UNC) Desoldering iron, LR 21 and LR 82 Antistatic soldering pencils

#### AK 20 (005 15 030 99)



Support for DSX 80 (DS 80 UNC) Desoldering iron and HAP 1 Hot air pencil

#### AK 21 (005 15 012 99)



Support for MPR 80 Peritronic soldering pencil

#### AK 51 (005 15 042 99)



Support for WTA 50 Tweezer

#### AKV (005 15 038 99)



Support for DSVT80 and DSXV 80 (DSV 80UNC) Desoldering iron

#### KH 15 (005 15 019 99)



Support for MLR 21 Micro soldering pencil

#### KH 20 (005 15 020 99)



Support for LR 21 Antistatic soldering pencil and HAP 1 Hot air pencil

#### KH 25P (005 15 033 99)



Support for MPR 80 Peritronic soldering pencil

#### KH 27 (005 15 027 99)



Support for LR 82 Soldering iron, HAP 1 and WSP 150

#### WPH 80 (005 15 140 99)



Support for WSP 80 Micro soldering pencil

#### WPHM (WPHM)



support for WMP micro soldering pencil

#### Sponge (005 22 419 99) 5 pcs.



70 x 55 x 16 mm



## WMD 3

Consists of:

- Power unit

**Order No.:** 005 33 026 99  
(UK: 005 33 023 99)



## WMD 1A

Consists of:

- Power unit WMD 1S 005 33 286 99  
(UK: 005 33 283 99)
- Hot air pencil HAP 1 005 27 115 99
- Holder KH 27 005 15 027 99
- Nozzle R 04 005 87 278 21
- Nozzle R 06 005 87 278 22
- Cleaning set 005 13 500 99

**Order No.:** 005 33 306 99  
(UK: 005 33 303 99)



## WMD 1D

Consists of:

- Power unit WMD 1S 005 33 286 99  
(UK: 005 33 283 99)
- Desoldering iron DSX 80 005 13 190 99
- Holder AK 20 005 15 030 99
- Nozzle DX 112 005 13 142 99
- Nozzle DX 113 005 13 143 99
- Cleaning set 005 13 500 99
- Replacement glass tube 005 13 605 00

**Order No.:** 005 33 326 99  
(UK: 005 33 323 99)



## WDD 161V

Consists of:

- Power unit PUDD 161V 005 32 886 99  
(UK: 005 32 883 99)
- Desoldering iron DSX 80 005 13 190 99
- Soldering pencil WSP 80 005 29 161 99
- Holder AK 20 005 15 030 99
- Holder WPH 80 005 15 146 99
- Nozzle DX 112 005 13 142 99
- Nozzle DX 113 005 13 143 99
- Cleaning set 005 13 500 99
- Replacement glass tube 005 13 605 00

**Order No.:** 005 32 806 99  
(UK: 005 32 803 99)



## WDD 81V

Consists of:

- Power unit PUDD 81V 005 32 586 99  
(UK: 005 32 583 99)
- Desoldering iron DSX 80 005 13 190 99
- Holder AK 20 005 15 030 99
- Nozzle DX 112 005 13 142 99
- Nozzle DX 113 005 13 143 99
- Cleaning set 005 13 500 99
- Replacement glass tube 005 13 605 00

**Order No.:** 005 32 566 99  
(UK: 005 32 563 99)



## PUDD 81V

Consists of:

- Power unit PUDD 81V

**Order No.:** 005 32 586 99  
(UK: 005 32 583 99)



## WAD 101

Consists of:

- Power unit
- Hot air pencil HAP 1 005 27 115 99
- Holder KH 27 005 15 027 99
- Nozzle R 04 005 87 278 21
- Nozzle R 06 005 87 278 22
- Cleaning set 005 13 500 99

**Order No.:** 005 32 666 99  
(UK: 005 32 663 99)

**COOPER** Hand Tools

Campbell® CaulkMaster® Crescent® Diamond® Erem® Kahnetics® Lufkin®  
Nicholson™ Plumb® H.K.Porter® Weller® Wire-Wrap® Wiss® Xcelite®

GERMANY  
**Cooper Tools GmbH**  
Carl-Benz-Str. 2  
74354 Besigheim  
Tel: (07143) 580-0  
Fax: (07143) 580-108

FRANCE  
**Cooper Tools S.A.**  
25 Avenue Maurice Chevalier  
77832 Ozoir-la-Ferrière  
Tél: (1) 60.18.55.40  
Fax: (1) 64.40.33.05

GREAT BRITAIN  
**Cooper Tools Ltd.**  
Suite 15, Coniston House  
Towne Centre  
Washington, Tyne & Wear  
NE38 7RN  
Tel: (0191) 419 7700  
Fax: (0191) 417 9421

ITALY  
**Cooper Italia S.p.A.**  
Viale Europa 80  
20090 Cusago (MI)  
Tel: (02) 9033101  
Fax: (02) 90394231

SWITZERLAND  
**Erem S.A.**  
Rue de la Roselière 8  
1400 Yverdon les Bains  
Tel: (024) 426 12 06  
Fax: (024) 425 09 77