



Inductive sensor
Stainless steel front
Bi2-EG12F-AN6X-H1141

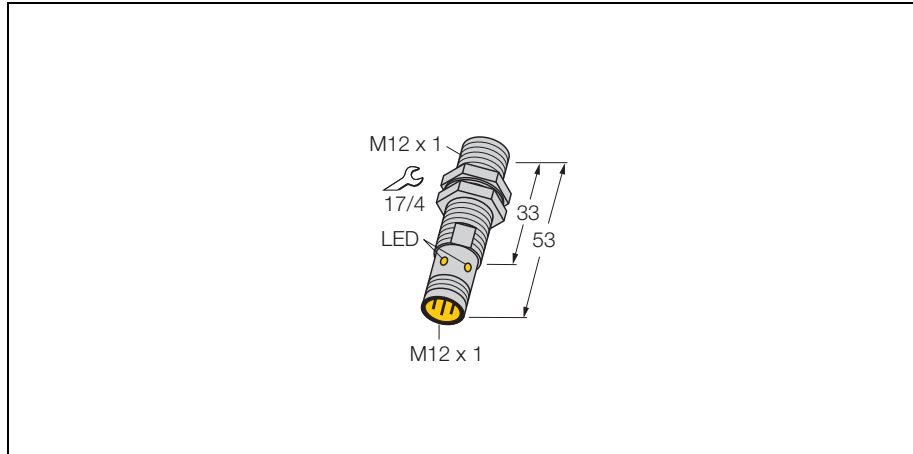

- Threaded barrel, M12x1
- Stainless steel, 1.4305
- 3-wire DC, 10...30 VDC
- normally open npn output
- connector, M12 x 1

Wiring diagram

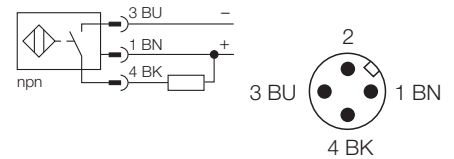

Type	Bi2-EG12F-AN6X-H1141
Ident-No.	4614636
Rated operating distance Sn	2 mm
Mounting condition	flush
Assured sensing range	≤ (0,81 x Sn) mm
Correction factors	St37 = 1, V2A ~ 0.7, Ms ~ 0.4, Al ~ 0.3
Temperature drift	≤ ± 10 %
Hysteresis	3... 15 %
Repeatability	≤ 2 %
Ambient temperature	-25...+ 70 °C
Operating voltage	10... 30 VDC
Residual ripple	≤ 10 % U _{ss}
DC rated operational current	≤ 200 mA
No-load current I ₀	≤ 15 mA
Residual current	≤ 0.1 mA
Rated insulation voltage	≤ 0.5 kV
Short-circuit protection	yes / cyclic
Voltage drop at I _e	≤ 1.8 V
Wire breakage / Reverse polarity protection	yes / complete
Output function	3-wire, NO contact, NPN
Switching frequency	≤ 0.1kHz
Housing	threaded barrel, M12 x 1
Dimensions	53 x 12 mm
Housing material	metal, V2A (1.4305)
Material active face	metal, V2A 1.4305
Admissible pressure on front cap	≤ 20 bar
Tightening torque of housing nut	10 Nm
Electrical connection	Connectors, M12 x 1
Vibration resistance	55 Hz (1 mm)
Shock resistance	30g (11 ms)
Protection class	IP68 / IP69K
Display switch state	LED yellow




Functional principle

Inductive sensors are designed for wear-free and non-contact detection of metal objects. For this purpose they use a high-frequency electro-magnetic AC field that interacts with the target. Concerning inductive sensors, this field is generated by an LC resonant circuit with a ferrite core coil.

Inductive sensor
Stainless steel front
Bi2-EG12F-AN6X-H1141

Mounting instructions	minimum distances
Distance D	35 mm
Distance W	8 mm
Distance T	12 mm (Fe metal); 70 mm (Fe non-metal)
Distance S	20 mm (Fe metal); 35 mm (non Fe-metal)
Distance G	40 mm

Diameter of the active area B	Ø 12 mm
--------------------------------------	---------

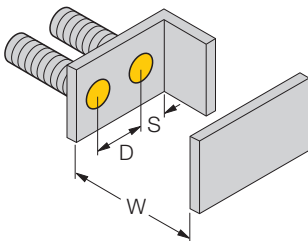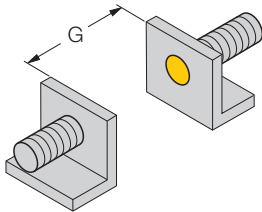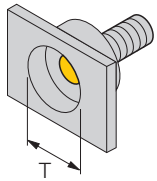

Switching distance not reduced when flush mounted in ferrous metals

When mounted in non-ferrous metals the active face has to protrude 16 mm.

The values depend on the mounting nuts used. Therefore we recommend the use of the nuts which are included in the delivery.