



DRAWING FOR REFERENCE: This is subject to change without notice
12/05/2013

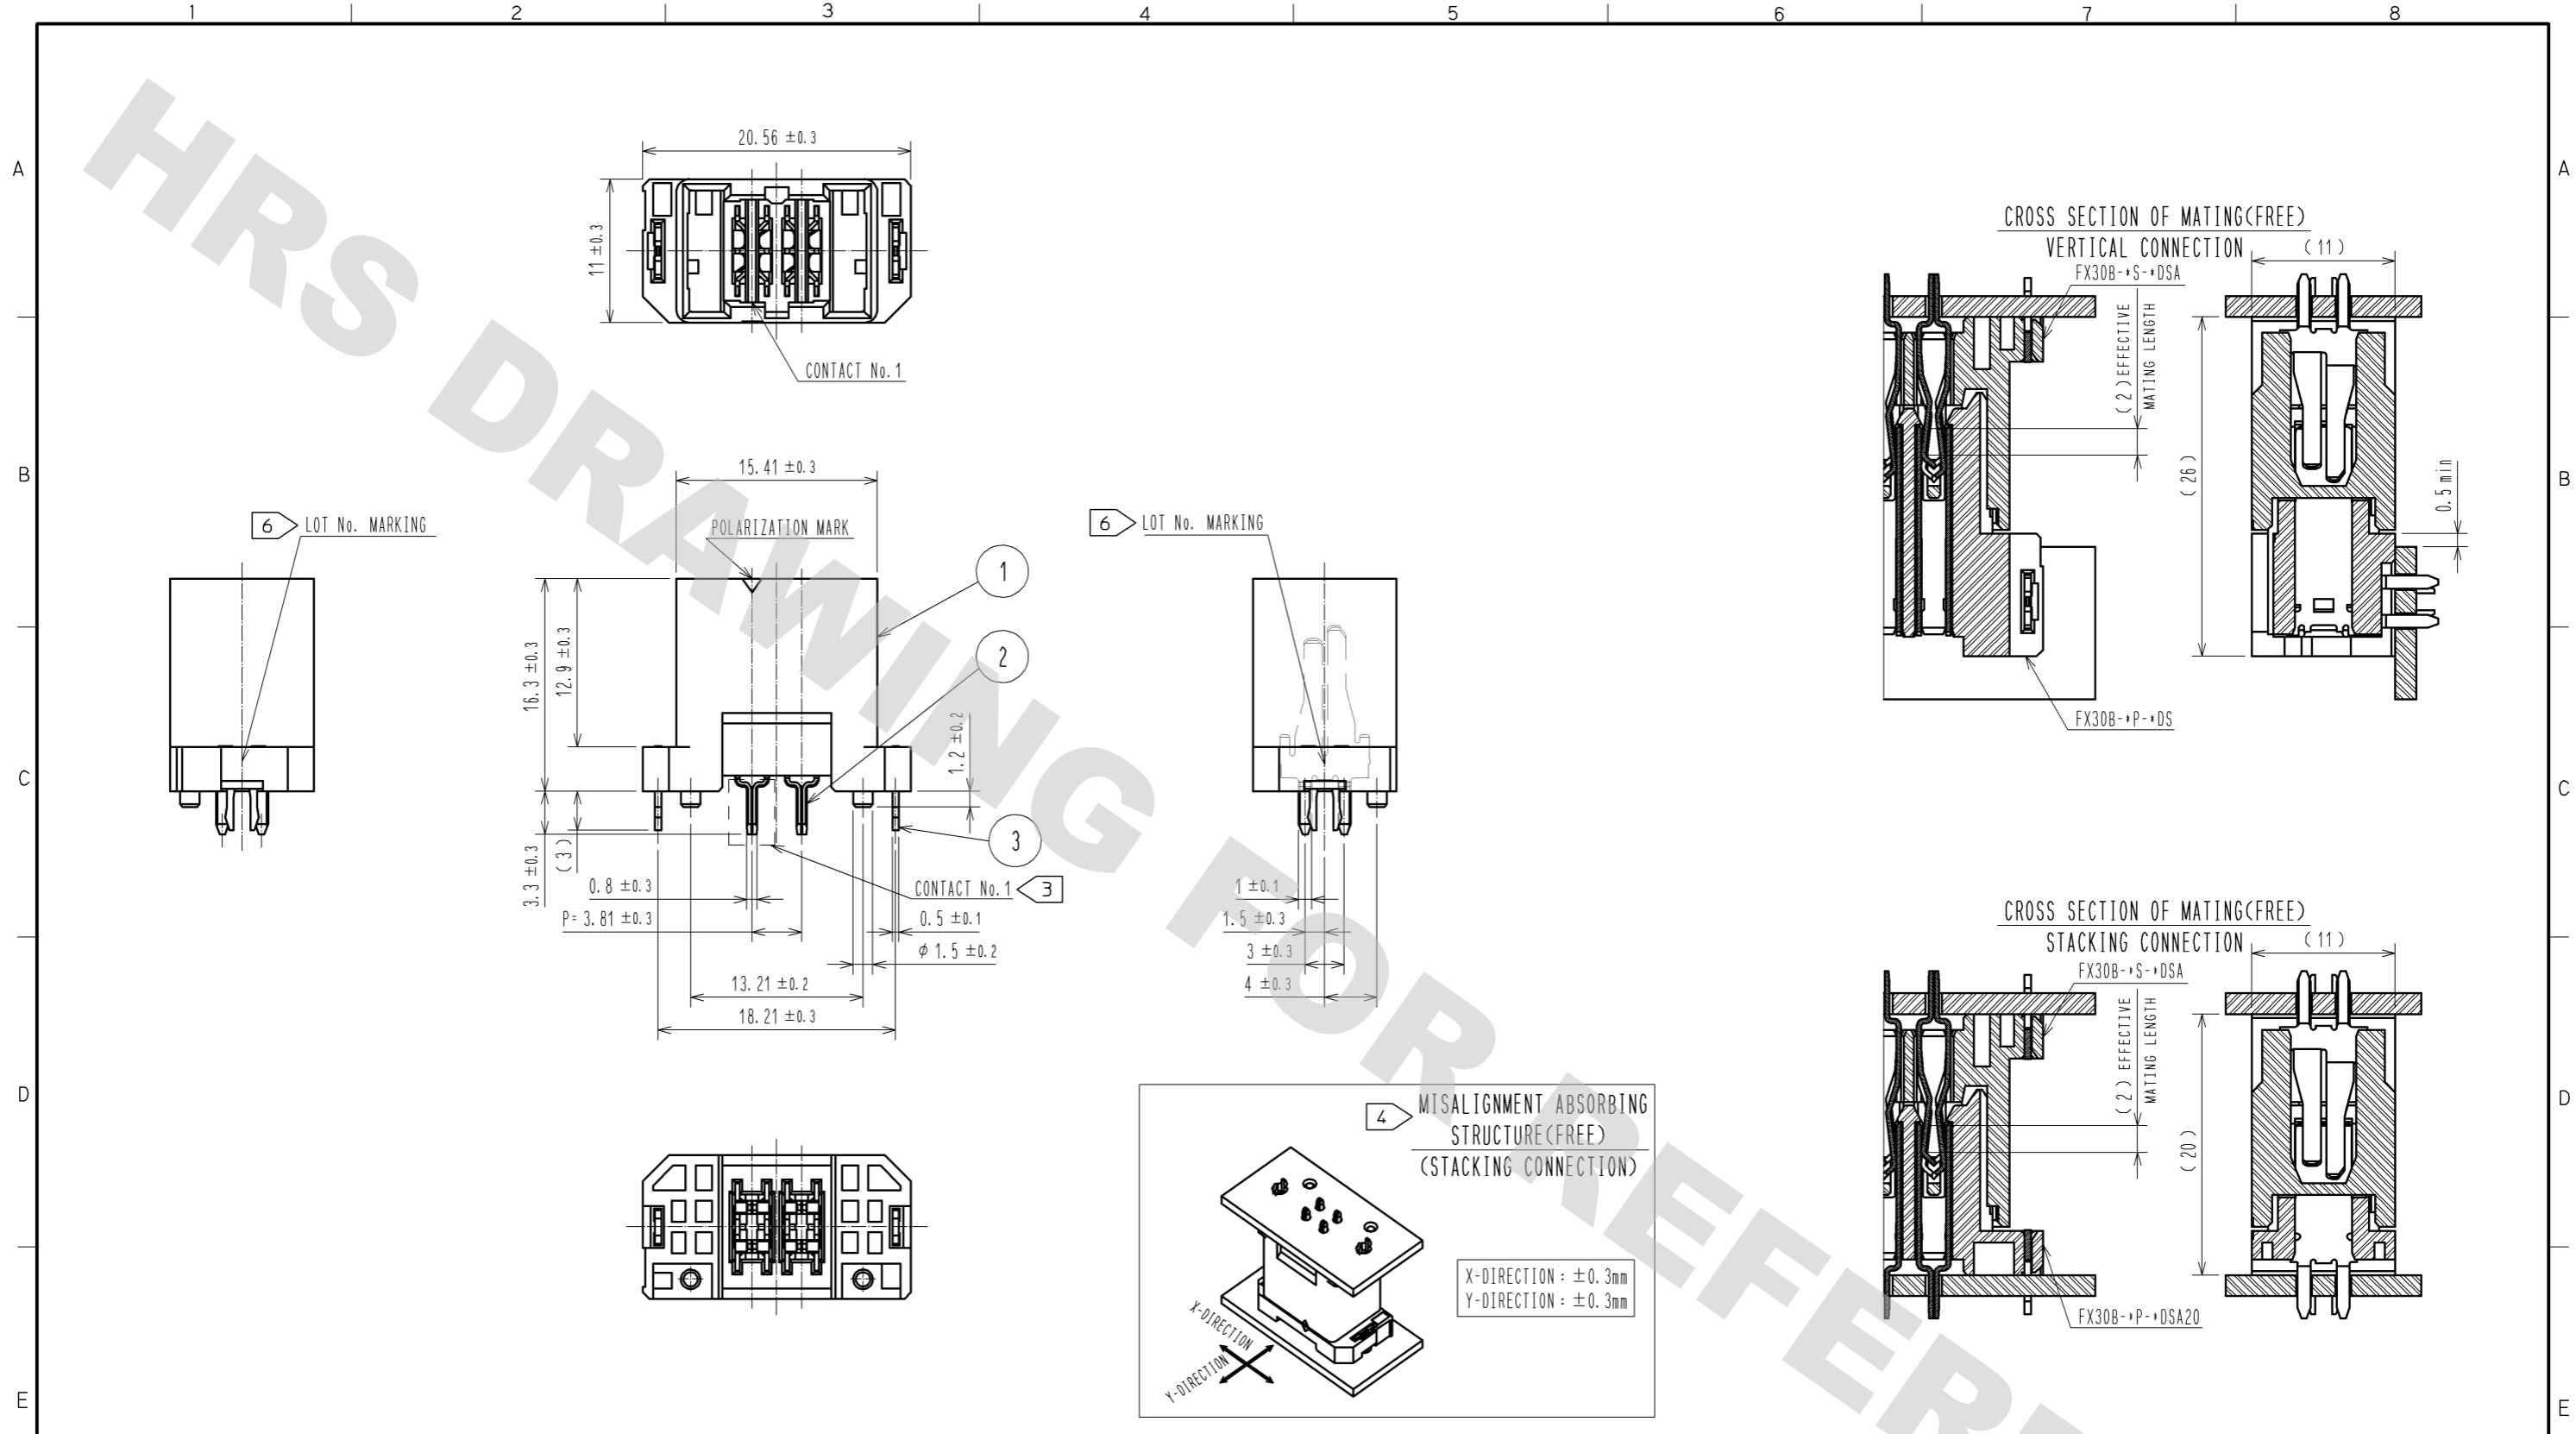

- NOTE
- ① THIS PRODUCT IS PACKAGED IN TRAY. (49pcs/TRAY)
 - ② BLEMISH AND HIT MARK CAN BE OCCURED THROUGH OUT THE MANUFACTURING PROCESS WHICH DOESN'T AFFECT QUALITY LEVEL. ALSO, BLACK SPOT COULD BE OBSERVED ON THE SURFACE OF HOUSING.
 - ③ FOR THE CONTACT NO., ADJACENT TWO PAIRS OF LEADS PLACED BACK-TO-BACK (4 LEADS IN TOTAL) COMPOSE ONE LINE.
 - ④ MISALIGNMENT ABSORBING RANGE: ±0.3mm max.
 - ⑤ THE DIMENSION IN PARENTHESES ARE FOR REFERENCES.
 - ⑥ LOT NO. IS INDICATED AT EITHER ONE OF THE POSITION AS SHOWN.

2	COPPER ALLOY	CONTACT AREA:GOLD-PLATING 0.1 μm	4	POLYSTYRENE			
		LEAD AREA:TIN-PLATING 1.0 μm					
		UNDER PLATING:NICKEL 1.0 μm	3	PHOSPHOR BRONZE	TIN-PLATING 3.0 μm		
1	POLYAMIDE	BLACK UL94V-0			UNDER PLATING:NICKEL 1.0 μm		
NO.	MATERIAL	FINISH . REMARKS	NO.	MATERIAL	FINISH . REMARKS		
UNITS mm		SCALE 2 : 1	COUNT △	DESCRIPTION OF REVISIONS	DESIGNED	CHECKED	DATE
HRS HIROSE ELECTRIC CO., LTD.		APPROVED : HS. OKAWA	13. 03. 07	DRAWING NO.	EDC3-347272-00		
		CHECED : KI. HIROKAWA	13. 03. 07	PART NO.	FX30B-2S-3. 81DSA		
		DESIGNED : DK. AIMOTO	13. 03. 07	CODE NO.	CL570-3500-1-00		
		DRAWN : DK. AIMOTO	13. 03. 07		△ 1/2		

DRAWING FOR REFERENCE: This is subject to change without notice
12/05/2013

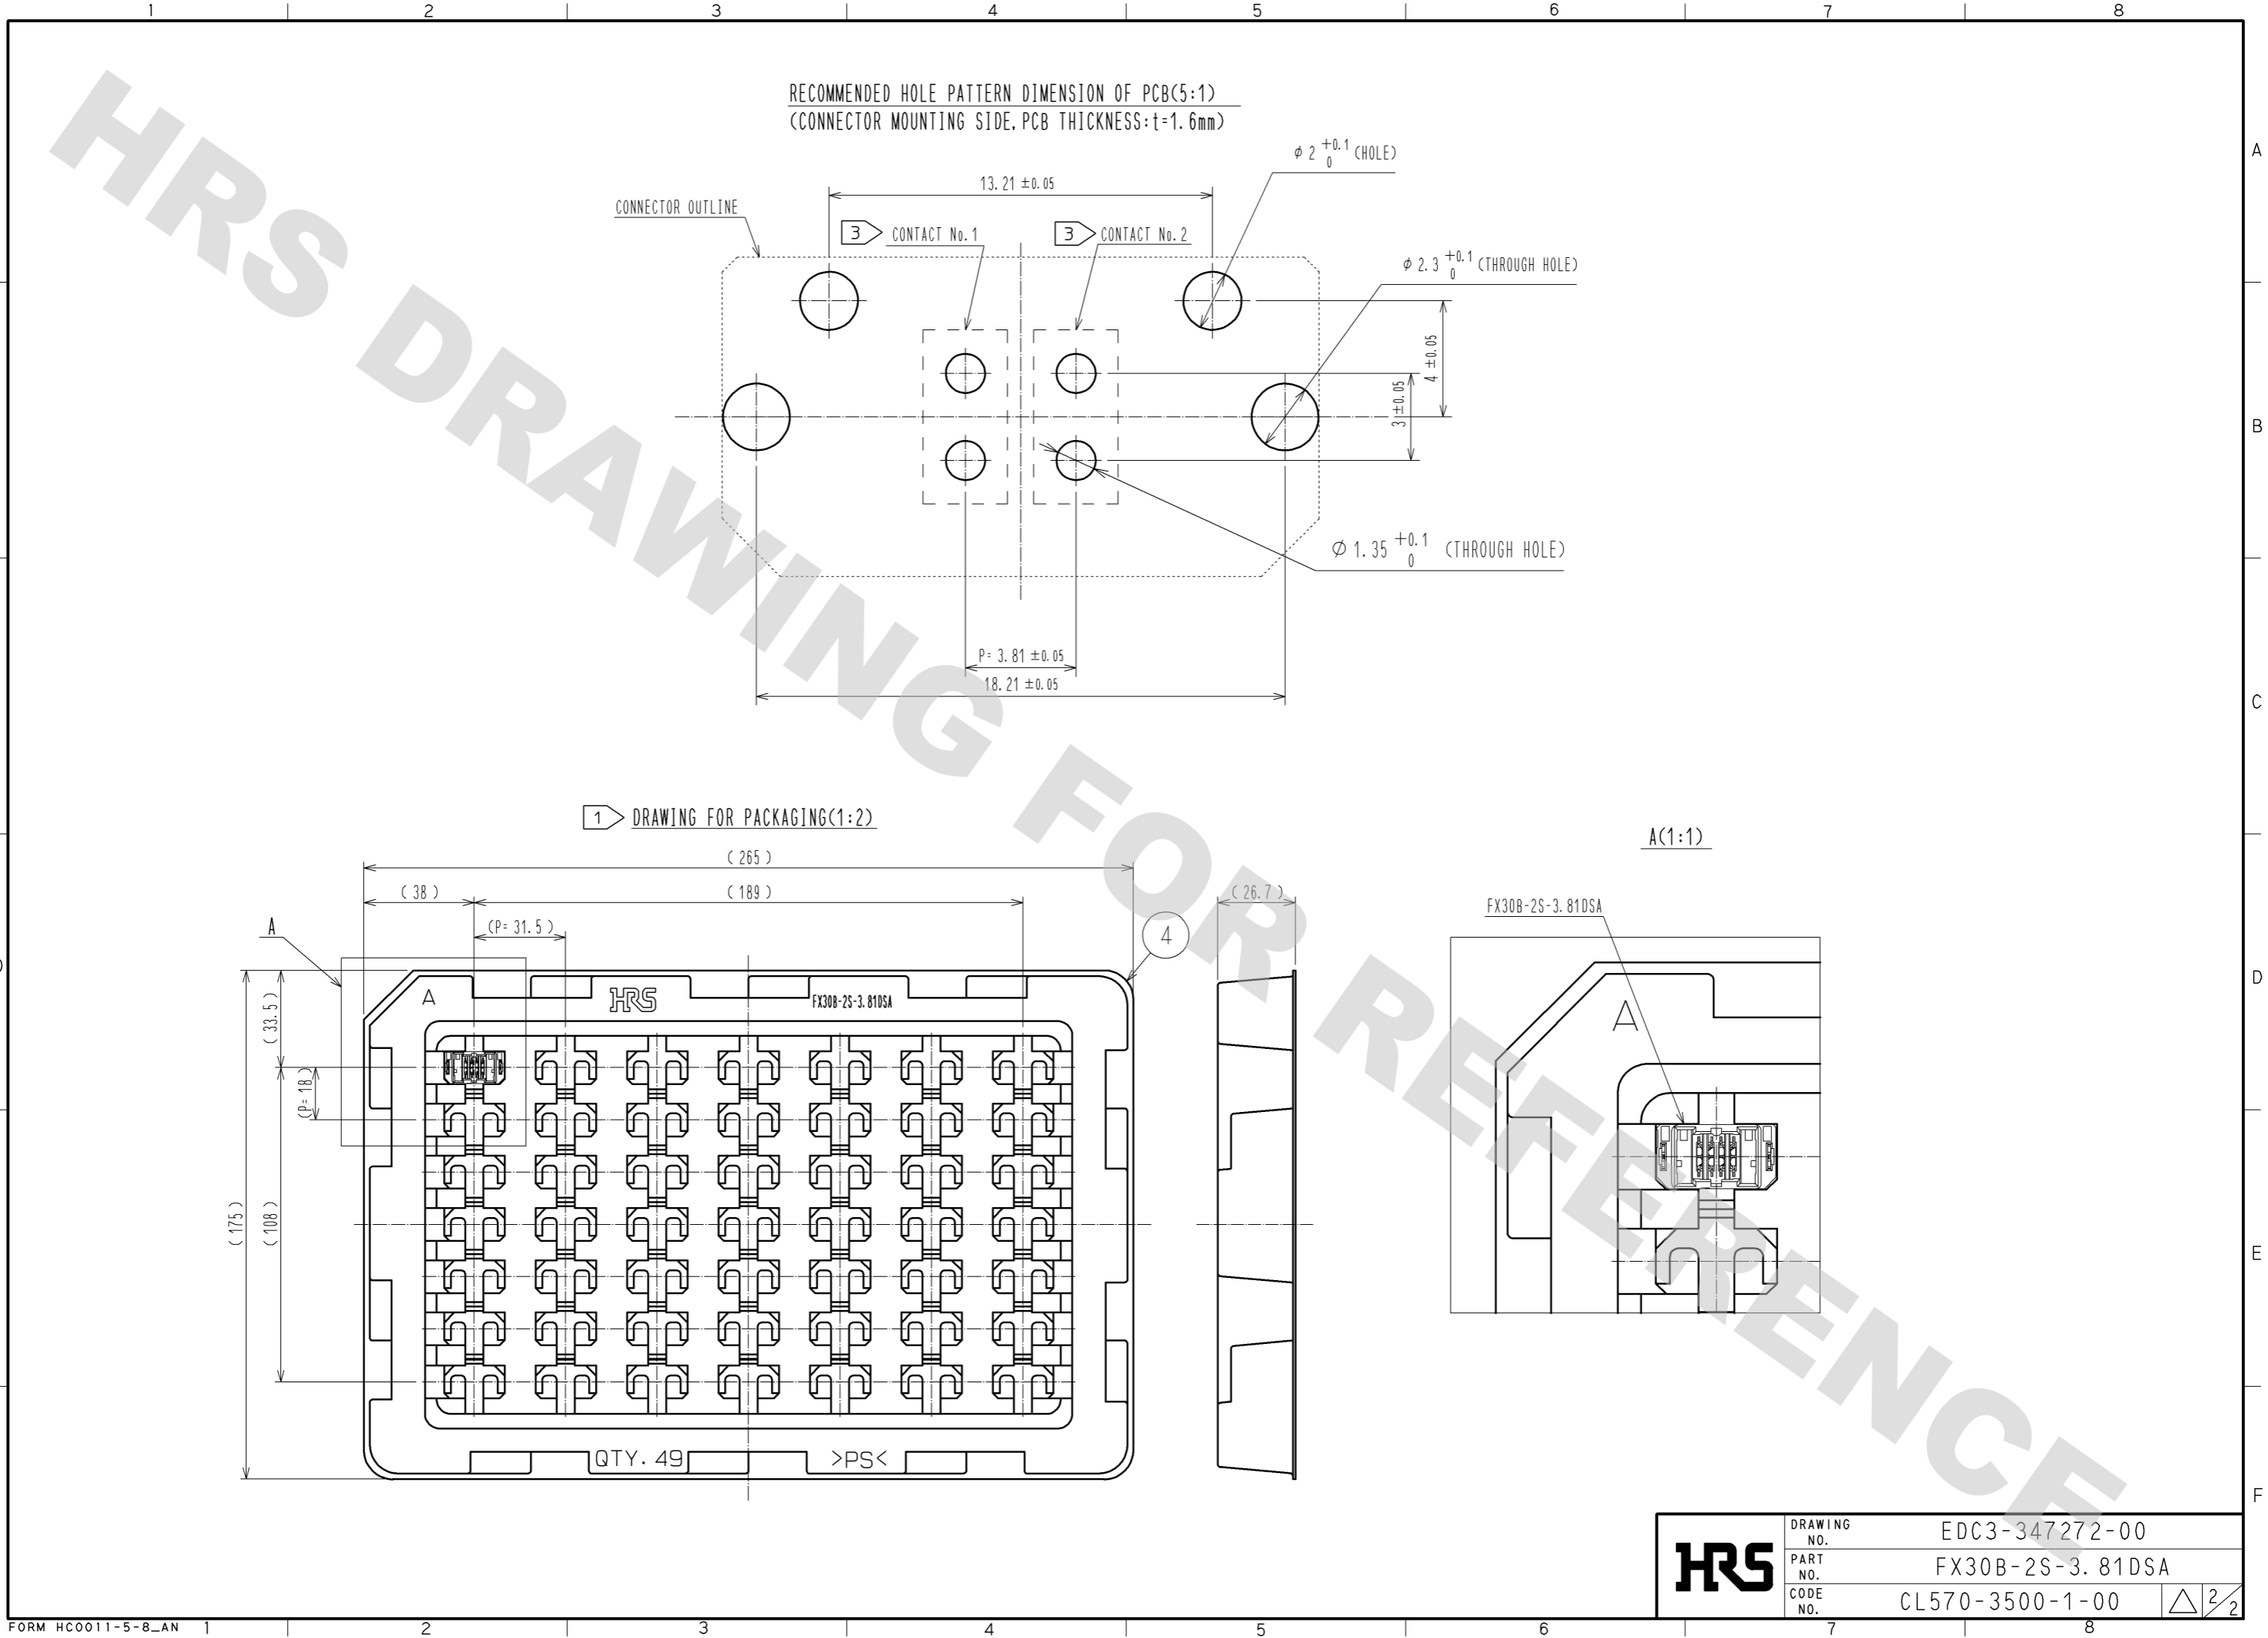

HRS	DRAWING NO.	EDC3-347272-00
	PART NO.	FX30B-2S-3.81DSA
	CODE NO.	CL570-3500-1-00
		\triangle 2/2